


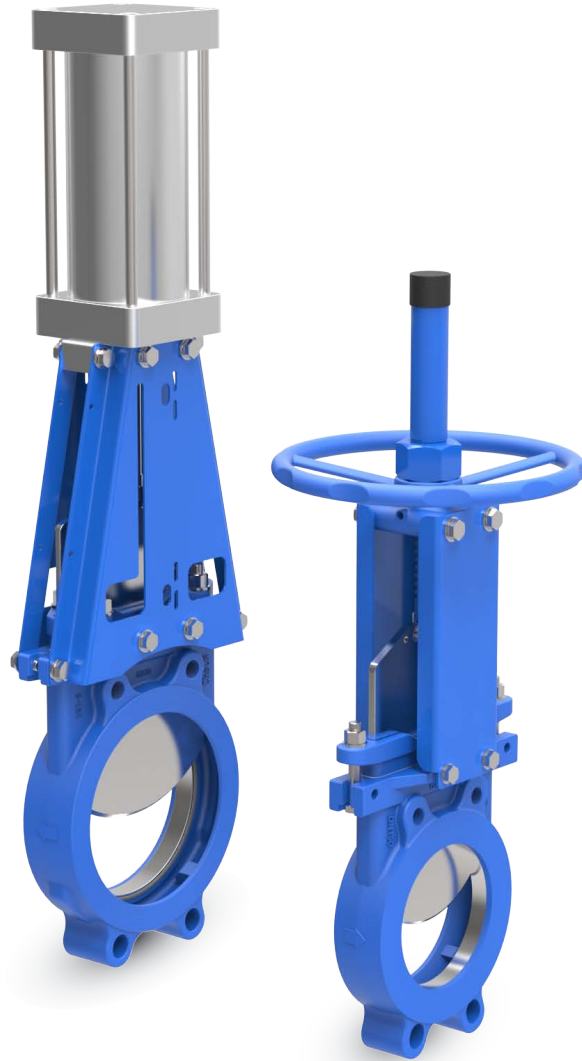


Uni-directional seal Knife Gate Valve

1. General Description


1.1 Description

Resta Knife gate valve is with replaceable rubber seal knife gate structure, its sealing principle is mainly by closely connection between gate and rubber seals. Its main characters is that the rubber sealing ring is set in seat' groove and is locked by metal seat, which will prevent rubber seal off when opening and closing the valve. If the seal is broken, you can remove the metal sear and replace the rubber seal, which will greatly improve valve' working efficiency. This valve is a cost-effective, high-performance products. The series of knife gate valve can be equipped with pneumatic actuators, in order to meet the requirements of different industrial and mining use.

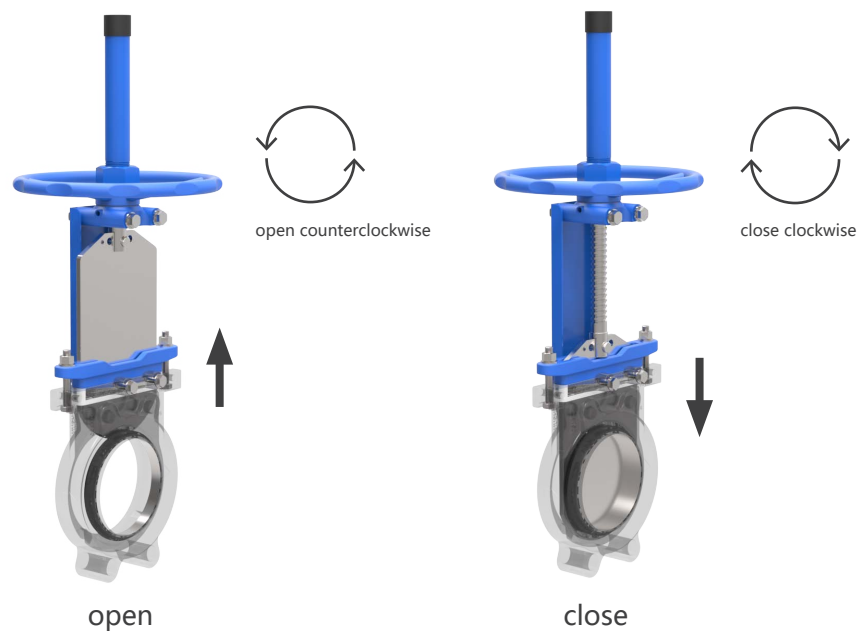

P1.1

1.2 Operation:

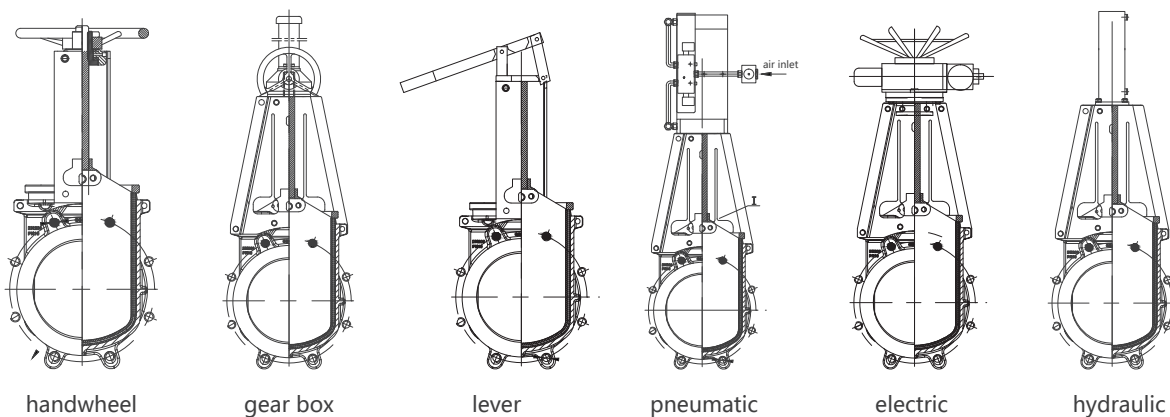

P1.2

2. Design standard

2.1 Medium:

Model:	RZ73X	
Working Pressure:	DN50-DN100	16bar
	DN125-DN200	14bar
	DN250-DN300	12bar
	DN350-DN400	10bar
	DN450-DN550	8bar
	DN600-DN650	5bar
	DN700-DN750	4bar
	DN800-DN900	3bar
	DN1000	2bar
Type:	Wafer,Lug,Flange	
Design Standard:	MSS SP-81	
Flange Standard:	PN10/PN16 10K 150LB TD TE	
Face to face:	MSS SP-81	
Testing Standard:	API-598	
Operation:	handwheel, electric, pneumatic, hydraulic, sprocket, electro-hydraulic, gear	
Main material:	2205,SS310,CF3M,CF3,CF8M,CF8,WCB,GGG40	
Disc material:	SS316L,SS316L,SS304	
Sealing material:	NBR,NR,EPDM,FKM,PTFE(leakage not recommend)	
Packing:	PTFE,high water based, aramid,rubber packing,graphite	
Applicable medium:	Applicable for coal in power plant, slag discharge, sewage treatment, food, paper making, medicine and chemical industry, water, Oil, steam, gold powder, ores, slag, coal, pulp, wood pulp, tailings, fibers, dust, chemicals, sewage treatment, asphalt, fruit juices, cereals, slaughter plant waste and other media.	


Note:

■ Diffrenct size working pressure was diffrent,pls make sure your order working pressure before order.

■ Working pressure was diffrent with flange standard pressure.(flange connection was PN10 not means the pipe inside pressure was 10bar)


3. Detail drawings and Data

3.1 Detail Drawing:

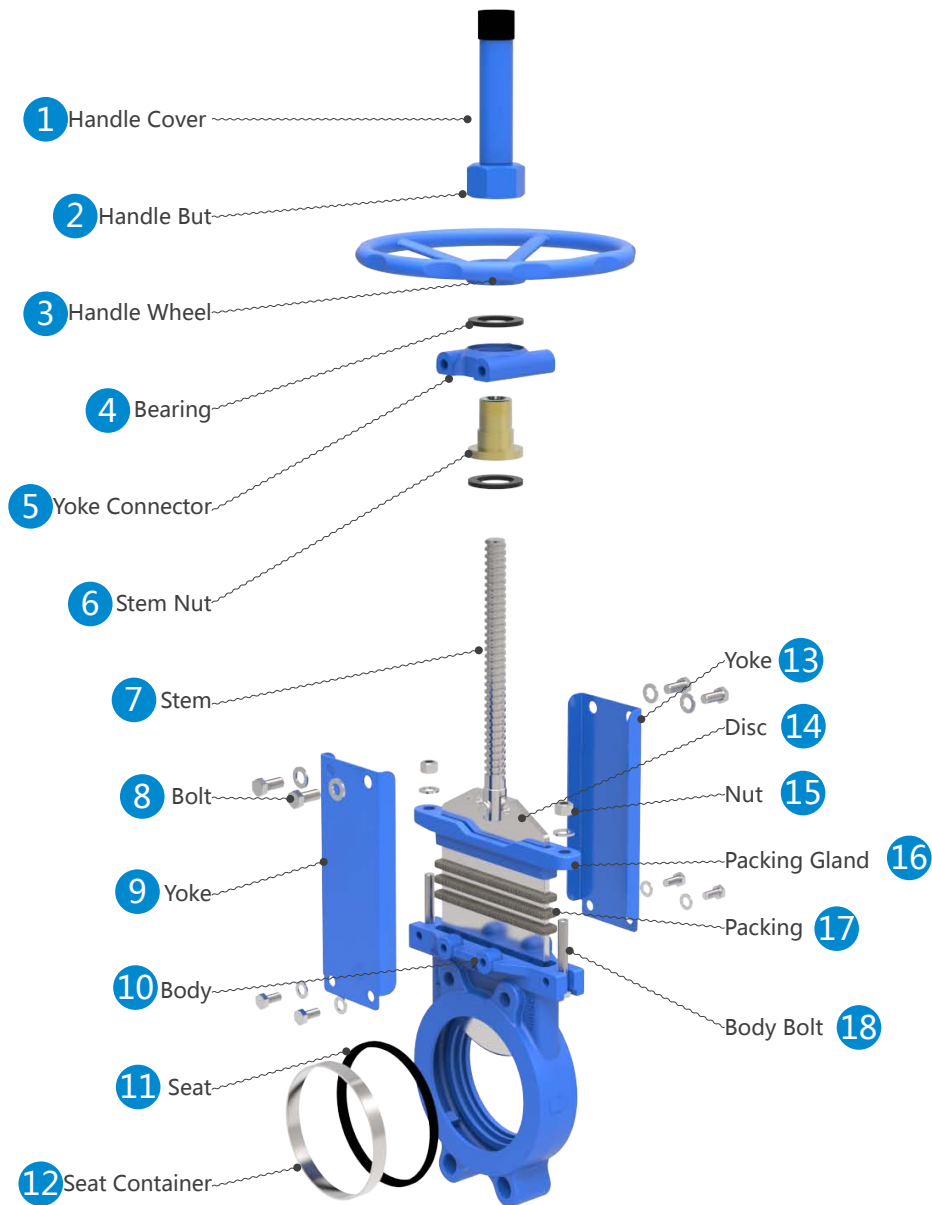

P 3.1


3.2 Detail Data:

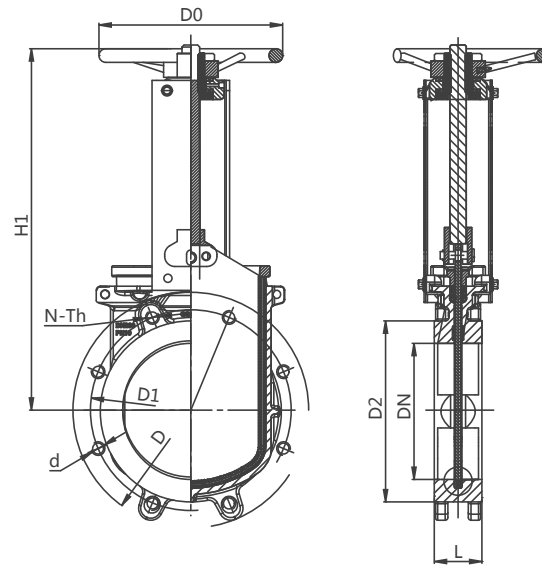

unit:mm

DIN PN10									ANSI 150LB								
DN	L	D	D1	D2	D0	N-Th	d	H1	DN	L	D	D1	D2	D0	N-Th	d	H1
50	48	165	125	99	180	4-M16	Ø18	290	2"	48	152	121	92	180	4-5/8"	Ø19	260
65	48	185	145	118	200	4-M16	Ø18	330	2-1/2"	48	178	140	105	200	4-5/8"	Ø19	292
80	51	200	160	132	200	8-M16	Ø18	358	3"	51	191	153	127	200	4-5/8"	Ø19	320
100	51	220	180	156	240	8-M16	Ø18	378	4"	51	229	191	157	240	8-5/8"	Ø19	358
125	57	250	210	184	260	8-M16	Ø18	428	5"	57	254	216	186	260	8-3/4"	Ø22	395
150	57	285	240	211	280	8-M20	Ø23	490	6"	57	279	242	216	280	8-3/4"	Ø22	450
200	70	340	295	266	300	8-M20	Ø23	588	8"	70	343	299	270	300	8-3/4"	Ø22	532
250	70	395	350	319	320	12-M20	Ø23	690	10"	70	406	362	324	320	12-7/8"	Ø25	670
300	76	445	400	370	350	12-M20	Ø23	815	12"	76	483	432	381	350	12-7/8"	Ø25	758
350	76	505	460	429	400	16-M20	Ø23	890	14"	76	533	476	413	400	12-1"	Ø29	857
400	89	565	515	480	450	16-M24	Ø27	980	16"	89	597	540	470	450	16-1"	Ø29	946
450	89	615	565	530	500	20-M24	Ø27	1025	18"	89	635	578	533	500	16-1 1/8"	Ø32	1023
500	114	670	620	582	500	20-M24	Ø27	1230	20"	114	699	635	584	500	20-1 1/8"	Ø32	Gear
550	114	725	680	638	-	20-M27	Ø30	1344	22"	114	750	692	641	-	20-1 1/4"	Ø35	Gear
600	114	780	725	682	-	20-M27	Ø30	1390	24"	114	813	750	691	-	20-1 1/4"	Ø35	Gear
700	127	895	840	794	-	24-M27	Ø30	1720	28"	127	927	864	800	-	28-1 1/4"	Ø35	Gear
800	127	1015	950	901	-	24-M30	Ø33	1862	32"	127	1060	978	914	-	28-1 1/2"	Ø41	Gear
900	127	1115	1050	1001	-	28-M30	Ø33	1910	36"	127	1170	1086	1022	-	32-1 1/2"	Ø41	Gear
1000	149	1230	1160	1112	-	28-M33	Ø36	Gear	40"	149	1290	1200	1124	-	36-1 1/2"	Ø41	Gear
1100	149	1340	1260	1220	-	28-M33	Ø36	Gear	44"	149	1405	1314	1245	-	40-1 1/2"	Ø41	Gear
1200	156	1455	1380	1328	-	32-M36	Ø39	Gear	48"	156	1510	1422	1359	-	44-1 1/2"	Ø41	Gear

3.2 Detail Data:

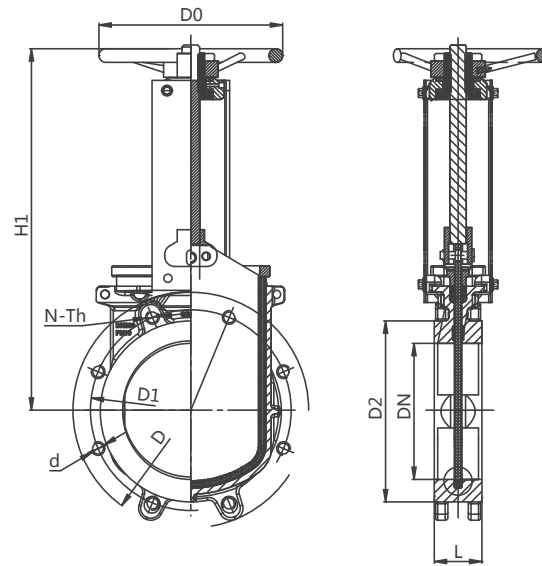


unit:mm

JIS 10K

Table E


DN	L	D	D1	D2	D0	N-Th	d	H1	DN	L	D	D1	D2	D0	N-Th	d	H1
50	48	155	120	96	180	4-M16	Ø19	290	50	48	152	114	89	180	4-M5/8-11	Ø19	290
65	48	175	140	116	200	4-M16	Ø19	330	65	48	165	127	102	200	4-M5/8-11	Ø19	330
80	51	185	150	126	200	8-M16	Ø19	358	80	51	184	146	121	200	4-M5/8-11	Ø19	358
100	51	210	175	151	240	8-M16	Ø19	378	100	51	216	178	153	240	4-M5/8-11	Ø19	378
125	57	250	210	182	260	8-M20	Ø23	428	125	57	254	210	184.5	260	8-M5/8-11	Ø19	428
150	57	280	240	212	280	8-M20	Ø23	490	150	57	279	235	210	280	8-M5/8-11	Ø19	490
200	70	330	290	262	300	12-M20	Ø23	588	200	70	337	292	267	300	8-M5/8-11	Ø19	588
250	70	400	355	324	320	12-M22	Ø25	690	250	70	406	356	328	320	12-M3/4-10	Ø22	690
300	76	445	400	368	350	16-M22	Ø25	815	300	76	457	406	378	350	12-M3/4-10	Ø22	815
350	76	490	445	413	400	16-M22	Ø25	890	350	76	525	470	439	400	12-M7/8-9	Ø26	890
400	89	560	510	475	450	16-M24	Ø27	980	400	89	578	521	489	450	12-M7/8-9	Ø26	980
450	89	620	565	530	500	20-M24	Ø27	1025	450	89	640	584	553	500	16-M7/8-9	Ø26	1025
500	114	675	620	585	500	20-M24	Ø27	1230	500	114	705	641	610	500	16-M7/8-9	Ø26	1230
550	114	745	680	640	-	20-M30	Ø33	1344	550	114	762	698	663	-	16-M1-8	Ø30	1344
600	114	795	730	690	-	24-M30	Ø33	1390	600	114	825	756	721	-	16-M1-8	Ø30	1390
650	114	845	780	740	-	24-M30	Ø33	1595	700	127	895	840	794	-	16-M1-8	Ø30	1595
700	127	905	840	800	-	24-M30	Ø33	1720	750	127	996	927	889	-	20-M1 1-8-7	Ø32	1720
750	127	970	900	855	-	24-M30	Ø33	1862									
800	127	1020	950	905	-	28-M30	Ø33	1910									
850	127	1070	1000	955	-	28-M30	Ø33	-									
900	127	1120	1050	1005	-	28-M30	Ø33	-									
1000	149	1235	1160	1110	-	28-M30	Ø33	-									
1100	149	1345	1270	1220	-	28-M36	Ø33	-									
1200	156	1465	1380	1325	-	32-M36	Ø39	-									

PN10 Threaded Hole and Through Hole

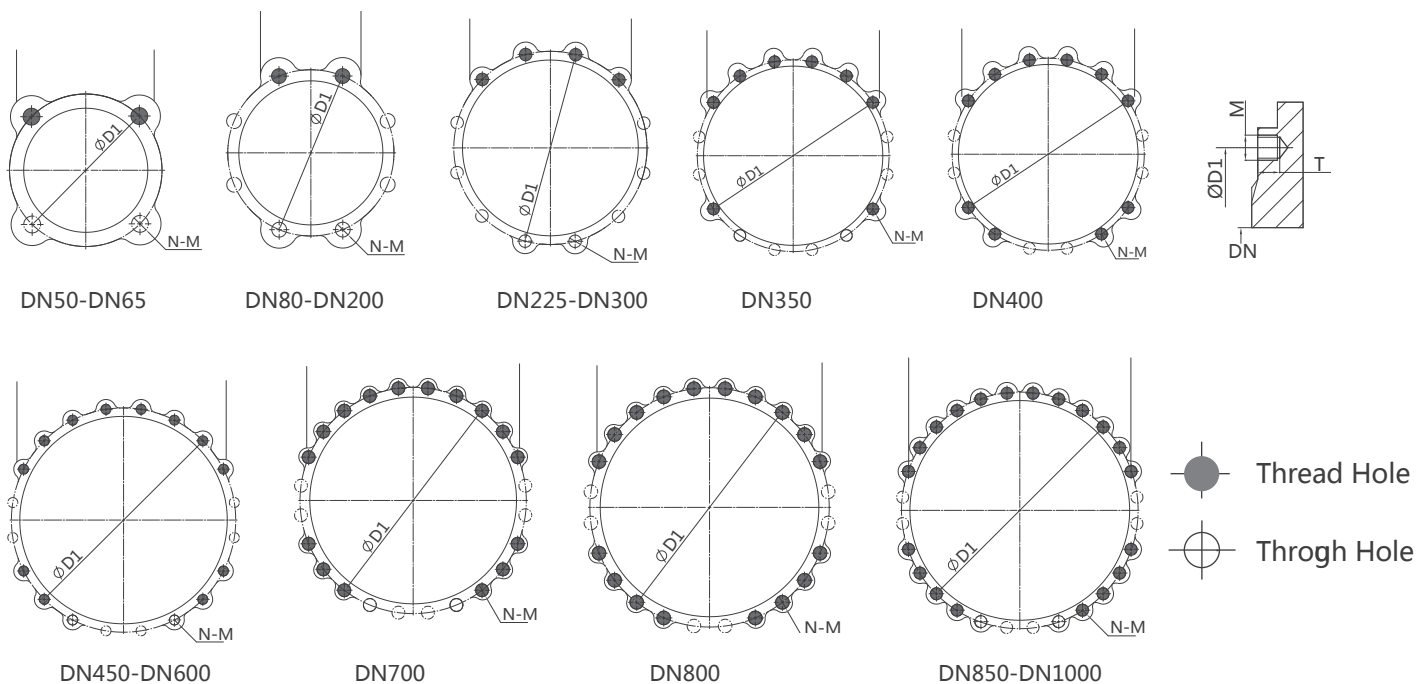


PN10						
DN	D1	N	M	T	Thread Hole	Through Hole
50	125	4	M16	13	2	2
65	145	4	M16	13	2	2
80	160	8	M16	13	2	6
100	180	8	M16	13	2	6
125	210	8	M16	16	2	6
150	240	8	M16	16	2	6
200	295	8	M20	20	2	6
225	310	12	M20	20	4	8
250	350	12	M20	20	4	8
300	400	12	M20	20	4	8
350	460	16	M20	20	8	8
400	515	16	M24	24	10	6
450	565	20	M24	24	12	8
500	620	20	M24	24	12	8
550	680	20	M27	24	12	8
600	725	20	M27	27	12	8
700	840	24	M27	27	16	8
800	950	24	M30	30	18	6
900	1050	28	M30	30	20	8
1000	1160	28	M33	33	20	8


150LB Threaded Hole and Throgh Hole

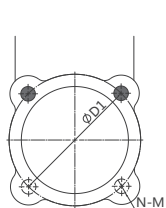


DN50-DN80

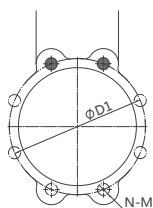


DN100-DN200

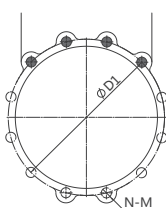



DN250

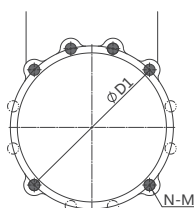


DN300-DN350

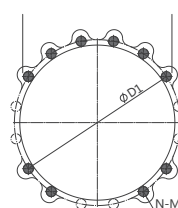


DN400-DN450

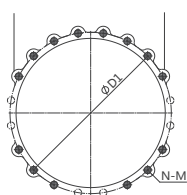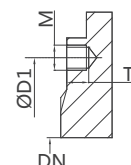


DN500-DN600

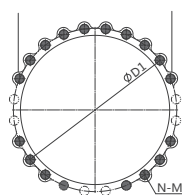


DN650

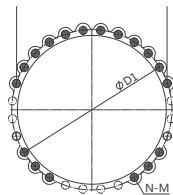


DN700-DN800

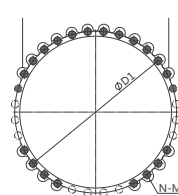

DN850-DN900

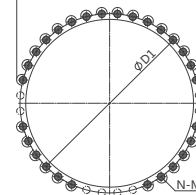



DN1000

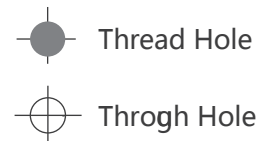

ANSI 150LB						
DN	D1	N	M	T	Thread Hole	Through Hole
2"(DN50)	121	4	M5/8-11	13	2	2
2-1/2"(DN65)	140	4	M5/8-11	13	2	2
3"(DN80)	153	4	M5/8-11	13	2	2
4"(DN100)	191	8	M5/8-11	13	2	6
5"(DN125)	216	8	M3/4-10	16	2	6
6"(DN150)	242	8	M3/4-10	16	2	6
8"(DN200)	299	8	M3/4-10	20	2	6
10"(DN250)	362	12	M7/8-9	20	4	8
12"(DN300)	432	12	M7/8-9	20	6	6
14"(DN350)	476	12	M1-8	20	6	6
16"(DN400)	540	16	M1-8	24	10	6
18"(DN450)	578	16	M1 1/8-7	24	10	6
20"(DN500)	635	20	M1 1/8-7	24	14	6
22"(DN550)	692	20	M1 1/4-7	24	14	6
24"(DN600)	750	20	M1 1/4-7	27	14	6
26"(DN650)	806	24	M1 1/4-7	27	18	6
28"(DN700)	864	28	M1 1/4-7	27	18	10
30"(DN750)	914	28	M1 1/4-7	27	18	10
32"(DN800)	978	28	M1 1/2-6	30	18	10
34"(DN850)	1029	32	M1 1/2-6	30	22	10
36"(DN900)	1086	32	M1 1/2-6	30	22	10
40"(DN1000)	1200	36	M1 1/2-6	33	28	8

4. Handling and installation

4.1 Handling:

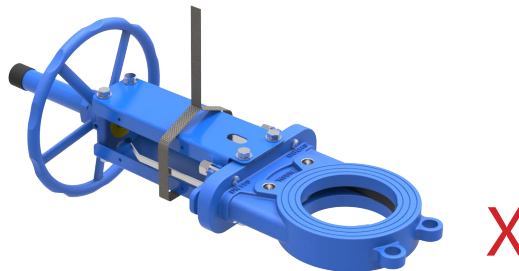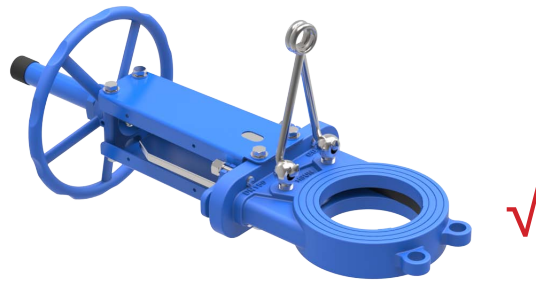


P 2.1

Note:

- It is strongly required to use gloves, helmets and work shoes throughout handling
- It is best to use metal hooks to move the valve
- Do not carry valve with hooks or straps from the yoke

4. Handling and installation

4.2 Installation Direction:

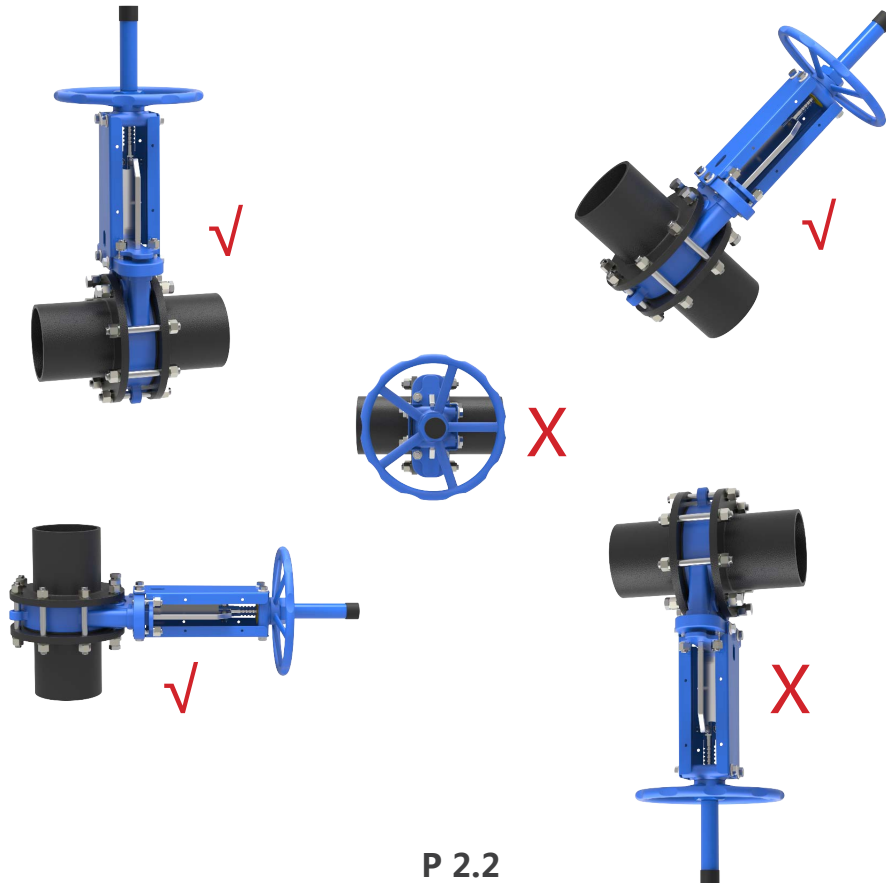

P 2.2

Note:

- It is strongly required to use gloves, helmets and work shoes throughout installation.
- Before installation, select the appropriate bolt, bolt selection, please refer to the data.
- Between the flange and the flange must have a gasket connection.

4.3 Installation Guide:

Note:

- Once the valve has been installed, check that all the screws and nuts have been correctly tightened and that the whole valve action system has been correctly adjusted (electrical connections, pneumatic connections, instruments...). Even if the valve has been assembled and tested at CHISUN during the handling and transport the screws on the packing gland tend to come loose and must be re-tightened.

5. Maintain and replace accessories

5.1

5.1.1 In the valve open state, regularly to the [stem](#) [7](#) and [disc](#) [14](#) oil. regularly tight bolts, make sure pipe flange position no leaking, make sure During the opening and closing of the valve, the [Yoke](#) [9](#) is not loose

5.1.2 Maintenance in use, every 30-40 day (According to the actual conditions to increase and shorten the interval time In the valve open state oil between knife and packing gland, also the stem oil.

5.1.3 about storage: 1. Store in an indoor or top-of-the-box building at the appropriate temperature. (-10°C ~ 40°C)
2. Recommended to store the valve in full or closed state.
3. Do not store in a sunny environment



5.2 Replace accessories:


5.2 Step 1

counterclockwise turning the [wrench](#) to disassemble the stem nut.




5.2 Step 2

Remove the [handwheel](#) [3](#) and the [positioning plate](#) in the direction of the arrow

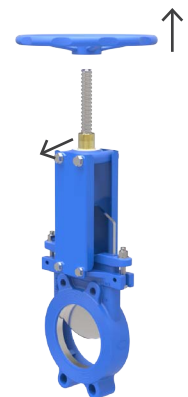

5.2 Step 3


Remove the [Yoke](#) [9](#) [Stem](#) [7](#) [Yoke head](#) [5](#) [Nut Bearing](#) [4](#) and [Disc](#) [14](#) in the direction of the arrow

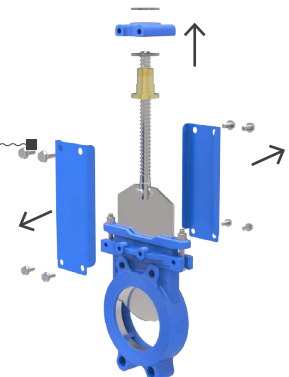

5. Maintain and replace accessories

5.2 Step 4

Move out Packing gland 12 and Disc 14 washer and nut from the top of the valve body.




5.2 Step 5

Take out the Packing 13



5.2 Step 6

Take out the Seat Container 12 and Seat 11

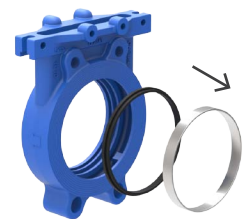

5.2 Step 6

Install replacement Seat 8 and Packing 13, Reinstall other components.

Repeat the above steps

6. Operation


6.1 Handwheel operation ■

Handwheel operation is one of the most commonly used valve opening methods, Usually used in small size valves(DN50-DN450).Turn the handwheel counterclockwise to turn on and turn it clockwise




6.2 Gear box operation ■

Gear box operation is one of the most commonly used valve opening methods, Usually used in big size valves(DN500 and bigger).Turn the handwheel counterclockwise to turn on and turn it clockwise,torque was smaller than handwheel.but turn on and off speed was slow.

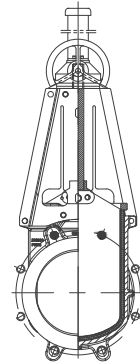

6.3 Lever operation ■

Gear box operation is one of the most commonly used valve opening methods, Usually used in big size valves(DN500 and bigger).Turn the handwheel counterclockwise to turn on and turn it clockwise,torque was smaller than handwheel.but turn on and off speed was slow.

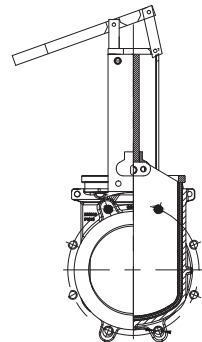

6.4 Pneumatic actuator ■

The default pneumatic actuator is a double acting actuator,Pneumatic actuators open and close pressure was 6bar-8bar.before use,open and close the actuators more than 2time.Gas source,The air supply requires clean and dry




6.5 Electric actuator

According to customer requirement,we supply diffrent type and brand.

7. Flange installation Instructions

7.1 Flange installation:

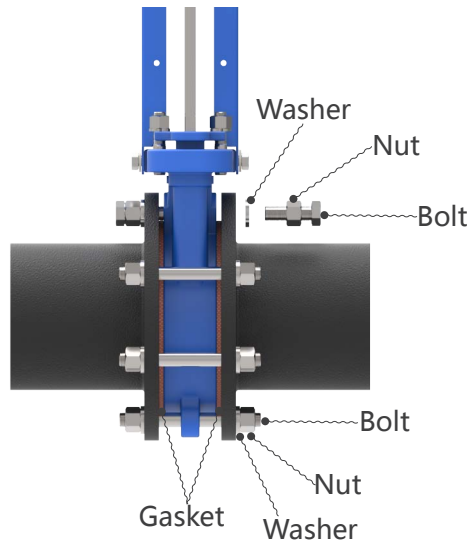

Note:

- Recommended to install as shown above picture,thread hole use washer-nut-bolt assembly,normal hole as washer-nut-bolt assembly.
- Do not install bolts with less quantity.

7.2 Assemble Direction :



1.Before installation on the pipe,pls be very carful the installation direction,The direction of the fluid must be the same as the direction indicated by the arrow of the valve body

2.If the medium is dry powder, dry coal slag, dry slag, etc., can also be installed in reverse(It must be supervised by the engineer on site)

7.3 Torque data:

	DN50	DN65	dn80	DN100	DN125	DN150	DN200	DN250	DN300	DN350	DN400	DN450	DN500	DN600	DN700
Torque(N.M)	3	3	3	4	4	6	7	15	29	57	60	73	171	172	180
Thrust(N.M)															



8. Sealing material selection table

	A-excellent	B- good	C-ordinary	X-bad			
name	natural rubber	Styrene Butadiene	Nitrile Butadiene Rubber	Ethylene-Propylene-Diene Monomer	Silica	fluororubber	polyurethane
code	NR	SBR	NBR	EPDM	Si	FKM	PU
Min °C	-75	-55	-40	-55	-110	-30	-30
max °C	70	70	100	125	225	250	100
hard(shore A)	30~90	40~90	40~90	40~90	40~80	55~90	50~80
tensile(kgf/cm ²) max	35	25	25	20	15	20	20
mineral oil	X	X	A	X	B	A	A
sulfuric acid	C	C	C	A	X	A	C
toluene	X	X	X	X	X	A	A
alcohol	B	B	A	A	X	A	X
Ether	X	X	C	X	X	X	C